




CARR CONCRETE

400 GALLON WATERER - TECHNICAL INFORMATION

SPECIFICATIONS

Weight.....	4,500 pounds
Height.....	30 inches
Diameter.....	6'-6"
Steel Reinforcing.....	120 feet of ½ inch reinforcing rod.
Wall Thickness.....	4 inches at top, 8 inches at bottom, (tapered to minimize freeze damage)
Bottom Thickness.....	4 inches
Inlet and Outlet.....	1 ¼ or 1 ½ inch cast in place galvanized couplings. Brass fittings or different sized optional at extra cost.
SCS Approved.....	Approved by SCS in OH, WV, and PA

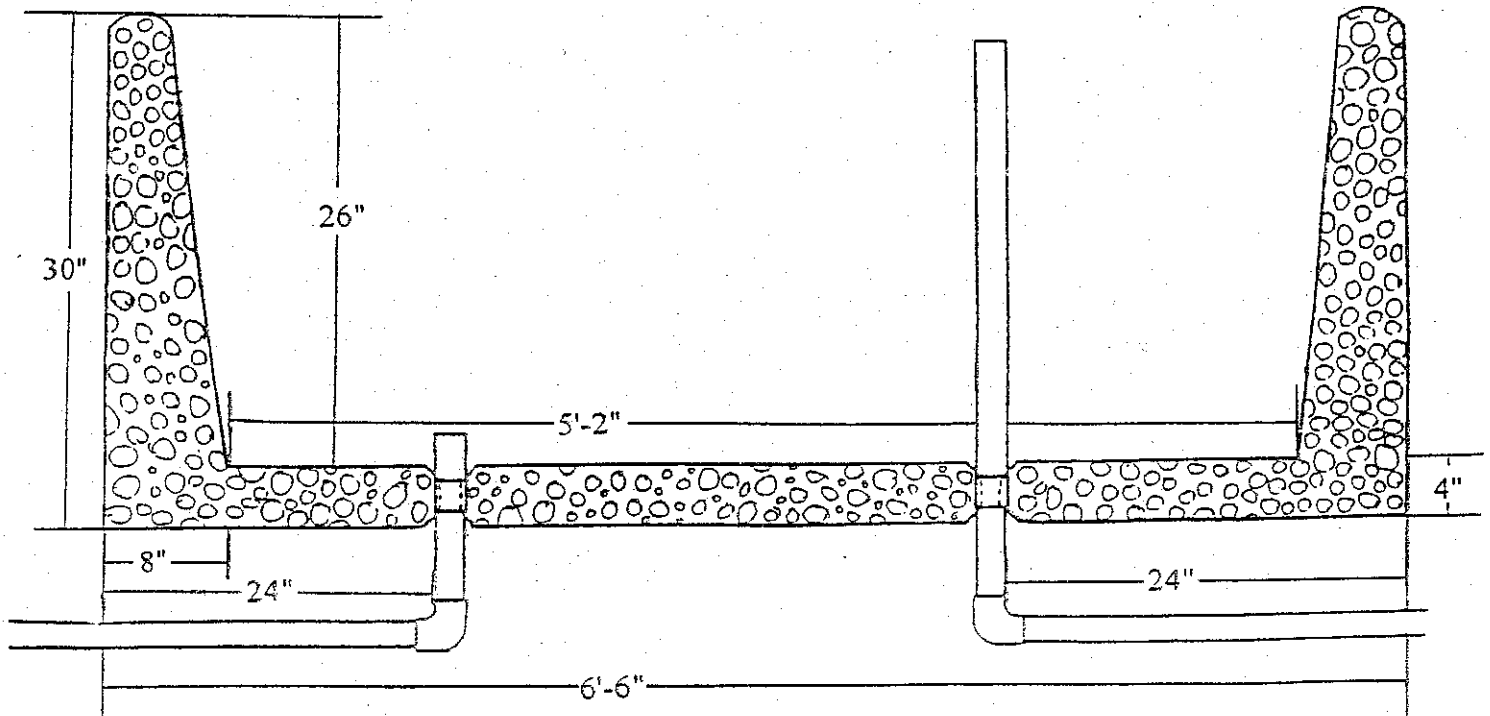

CARR CONCRETE CORPORATION

P.O. Box 265, Waverly, WV 26184-0265 Phone: 800-837-8918 Phone: 304-464-4441 Fax: 304-464-4013

Precast concrete products for industrial, commercial, agricultural and residential use.
Carr Concrete is certified by the National Precast Concrete Association.


INSTALLATION PROCEDURE

Excavate and level an area 7 ½ feet in diameter. Depth of excavation can be adjusted to produce desired height of finished installation. Dig a 10"-12" wide trench across the center of the excavation to the depth you want the lines buried (normally 12-18 inches.)


Set the tank on concrete blocks or other blocking material with the inlet and outlet lined up over the trench. Attach inlet and overflow lines using a nipple to come out of the bottom of the tank to desired depth. After lines are attached, raise tank, remove blocking and set the tank down. Make sure the lines are lowered into the trench. Pack earth into the trench and place stone around the tank. If ground is rocky, it is recommended that crushed stone be placed under the tank before installation.

When using a pressure system, the overflow pipe is optional.

SPRING FED INSTALLATION

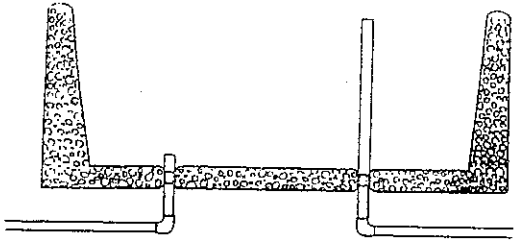

PRESSURE FED INSTALLATION

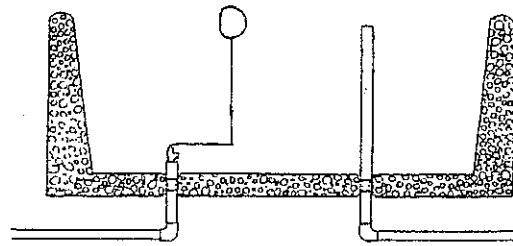

MAINTENANCE HINTS

Pressure relief devices - As water freezes, it expands with tremendous force against the sides of the tank. In order to relieve this pressure, a compressive material should be introduced into the water in the winter to absorb this pressure. Some materials we have seen used successfully include: (1) a tire set on end protruding through the surface of the water and held in place by a post laid across the top of the tank or (2) a plastic milk jug painted black on the inside and weighted with a handful of gravel. Fence posts are sometimes used, but are not very effective once they become water-logged.

Algae - Many methods have been used for keeping tanks free of algae, but the best method we have found is to put in a couple of small catfish.

LIMITED WARRANTY -

The 400 gallon waterer described below is warranted to be manufactured according to specifications submitted to and approved by State Conservation Engineer, Soil Conservation Service, States of West Virginia and Ohio. The waterer is produced of 5000 psi compressive strength concrete and reinforced with #4 (½ inch diameter) 60 grade reinforcing bar. It is warranted to be structurally sound and will not deteriorate, crack, leak, or be broken by livestock. This warranty will continue in force for a period of five (5) years from the date of installation.

The warranty does not apply if the tank has been moved from initial installation site, damaged by machinery, blasting, or Acts of God. The warranty does not apply if the owner allows water in the tank to freeze over the entire top surface. Although the tapered design, smooth walls, and heavy reinforcing are intended to minimize the effect of freezing, the tremendous pressures exerted when water freezes can fracture structures many times the thickness of this waterer. Contact your Soil Conservation Service or Carr Concrete Corporation for hints of how to keep an unfrozen portion on the surface or how to keep pressure relief structures in the tank during the winter months. If you cannot keep a surface opening for livestock to drink, the tank has no utility as a waterer and should be drained. It is suggested that all tanks controlled by float valve or other device where water does not flow through the tank continuously be drained.

If a leak occurs which is a result of a structural defect, inferior concrete, or other condition due to manufacturing, Carr Concrete Corporation will, at its option, repair or replace the waterer at our expense, excluding freight and installation.